

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch

690 Walnut Ave.St. 150

Vallejo, CA 94592-1133

(707) 649-5453

(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-017725**Date Inspected:** 22-Oct-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Qiu Wen**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG Components**Summary of Items Observed:**

On this date Caltrans Office of Structural Materials Quality Assurance Inspector, Sandeep Kumar (QA) was present during the times noted above for observations relative to the work being performed.

BAY#10

ORTHOTROPIC BOX GIRDER (OBG) AT BAY#10

This QA Inspector observed the following work in progress

Fluxcored Arc Welding (FCAW):

Weld joint # 08 located on Bike Path, top cover plate to side plate BK004A5 – 025. Welder is identified as 057180. ZPMC Quality Control (QC) Inspector is identified as Yu Zhi Lai. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2231 – Tc – U4c – F.

Weld joint # 10 located on Bike Path, top cover plate to side plate BK004A3 – 025. Welder is identified as 053869. ZPMC Quality Control (QC) Inspector is identified as Yu Zhi Lai. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2231 – Tc – U4c – F. (See attached photo)

Weld joint # 02 located on Bike Path, top cover plate to side plate BK004A5 – 025. Welder is identified as 057180. ZPMC Quality Control (QC) Inspector is identified as Yu Zhi Lai. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2231 – Tc – U4c – F.

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

BAY#11

ORTHOTROPIC BOX GIRDER (OBG) AT BAY#11

This QA Inspector observed the following work in progress

Fluxcored Arc Welding (FCAW):

Weld joint # 02 located on Bike Path BK004A8 – 018. Welder is identified as 049220. ZPMC Quality Control (QC) Inspector is identified as Xu Jie. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2332 – Tc – P4 – F. (See attached photo)

Weld joint # 01 located on Bike Path BK004A6 – 018. Welder is identified as 040723. ZPMC Quality Control (QC) Inspector is identified as Xu Jie. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2333 – Tc – P4 – F.

Weld joint # 07 located on Bike Path BK004A6 – 018. Welder is identified as 040723. ZPMC Quality Control (QC) Inspector is identified as Xu Jie. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2332 – Tc – P4 – F.

Weld joint # 43 located on Bike Path BK005B1 – 004. Welder is identified as 040723. ZPMC Quality Control (QC) Inspector is identified as Xu Jie. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2232 – Tc – U4c – F.

Weld joint # 43 located on Bike Path BK005B1 – 004. Welder is identified as 054460. ZPMC Quality Control (QC) Inspector is identified as Xu Jie. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2232 – Tc – U4c – F.

Shielded Metal Arc Welding (SMAW):


Weld joint # 022 located on Bike Path, BK004A6 – 022. Welder is identified as 040655. ZPMC Quality Control (QC) Inspector is identified as Wang Chuang Xin. The welding variables recorded by QC appeared to comply with the WPS – B – P – 2113.

Weld joint # 115 located on Bike Path, BK004A6 – 022. Welder is identified as 041271. ZPMC Quality Control (QC) Inspector is identified as Wang Chuang Xin. The welding variables recorded by QC appeared to comply with the WPS – B – P – 2113.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

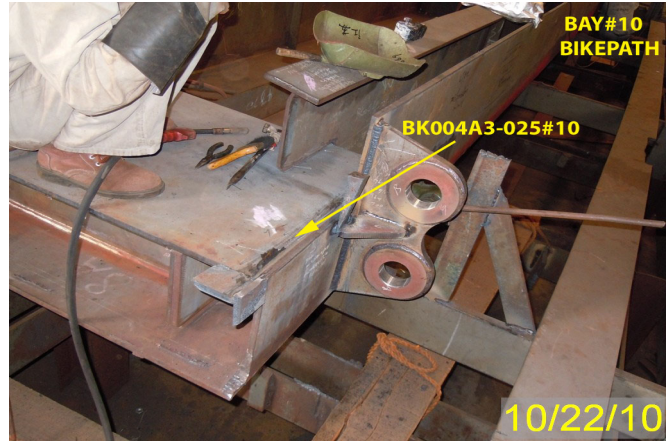

Summary of Conversations:

No Relevant Conversations.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Thomas Ho- 15002048250, who represents the Office of Structural Materials for your project.

Inspected By: Kumar,Sandeep

Quality Assurance Inspector

Reviewed By: Clifford,William

QA Reviewer